

Staff Report

Infill Housing Design Review Committee

File Number: 12-C-24-IH

Meeting:	12/18/2024
Applicant:	Edilmar Lopez LVZ Construction
Owner:	Edilmar Lopez LVZ Construction

Property Information

Location:	200 Hiawassee Ave.	Parcel ID 81 B G 001
Zoning:	RN-2 (Single-Family Residential Neighborhood)	
District:	Oakwood/Lincoln Park Infill Housing Overlay District	

Description of Work

Level III New Primary Structure

New primary structure fronting Hiawassee Ave. One-story residence features a hipped roof (8/12 pitch), an exterior of "horizontal siding" (material unspecified), and a slab foundation. The house is 33' wide by 50' deep and will be set 20' from the front property line. It features a partial-width, 6' deep front porch recessed under the primary roofline and supported by two square columns with a post and pier of unspecified material. Parking is a 10' concrete pad located in the front and accessed via Hiawassee Avenue.

The façade (north) features three bays, with a projecting front-gable massing with a paired picture window on the left bay, a projecting front-gable dormer with a window and quarter-lite door in the center bay, and a paired picture window on the right bay. The left elevation features one double-hung window and one small picture window. The right elevation features a paired picture window, and the rear elevation features two pairs of picture windows flanking a secondary entrance.

Applicable Design Guidelines

Heart of Knoxville Infill Housing Design Guidelines

1. Front Yards

- Consistent front yard space should be created along the street with the setback of a new house matching the older houses on the block.

- A walkway should be provided from the sidewalk or street to the front door. Along grid streets, the walk should be perpendicular to the street.

- Healthy trees that are outside the building footprint should be preserved. The root area should be marked and protected during construction.

2. Housing Orientation

- New housing should be proportional to the dimensions of the lot and other houses on the block.

- On corner lots, side yard setbacks should be handled traditionally (that is, closer to the side street). The zoning requirement to treat corner lots as having two frontages should not apply in Heart of Knoxville neighborhoods.

- Side yard setbacks should be similar to older houses on the block, keeping the rhythm of spacing between houses consistent.

3. Alleys, Parking, and Services

- Parking should not be in front yards.

- Alley access should be used for garage or parking pad locations. On level ground, pea gravel or similar material may be used as a parking pad off alleys.

- On streets without alleys, garages or parking pads should be at least 20 feet behind the front façade of the infill house with access limited to one lane between the street and the front façade.

- Garages which are perpendicular to the alley should be about 18 feet from the center line of the alley pavement, allowing a comfortable turning radius for a driver to enter a garage.

- Alley-oriented parking pads, garbage collection points, and utility boxes should be screened with a combination of landscaping and fencing.

- On those streets which have alleys, driveways should not be permitted from the front of the house.

- On corner lots, a driveway to the garage may be provided off the side street.

4. Scale, Mass, and Foundation Height

- The front elevation should be designed to be similar in scale to other houses along the street.

- The front façade of new houses should be about the same width as original houses on the block.

- New foundations should be about the same height as the original houses in the neighborhood.

- If greater height is to be created (with new construction or an addition), that portion of the house should be located toward the side or rear of the property.

5. Porches and Stoops

- Porches should be part of the housing design in those neighborhoods where porches were commonplace.

- Porches should be proportional to original porches on the block, extending about 8-12 feet toward the street from the habitable portion of the house.

- Porches should extend into the front yard setback, if necessary, to maintain consistency with similarly sited porches along the street.

- Porch posts and railings should be like those used in the historic era of the neighborhood's development. Wrought iron columns and other materials that were not used in the early 1900's should not be used.

- Small stoops centered on entry and no more than 5 feet deep are appropriate on blocks where porches were not traditional.

6. Windows and Doors

- When constructing new houses, the window and door styles should be similar to the original or historic houses on the block.

- To respect the privacy of adjacent properties, consider the placement of side windows and doors.

- The windows and doors on the front facade of an infill house should be located in similar proportion and position as the original houses on the block.

- Attention should be paid to window placement and the ratio of solid (the wall) to void (the window and door openings).

- Contemporary windows such as "picture windows" should not be used in pre-World War II neighborhoods.

7. Roof Shapes and Materials

- New roofs should be designed to have a similar pitch to original housing on the block

- More complex roofs, such as hipped roofs and dormers, should be part of new housing designs when such forms were historically used on the block.

- Darker shades of shingle were often used and should be chosen in roofing houses in Heart of Knoxville neighborhoods.

8. Siding Material

- Clapboard-like materials (such as cement fiberboard) should be used in constructing new housing where painted

wood siding was traditionally used.

- Brick, wood shingle, and other less common material may be appropriate in some older neighborhoods, particularly those with a mix of architectural styles.

- Faced stone, vertical siding, and other non-historic materials should not be used in building new houses. In 1930-1950 era neighborhoods, faced stone may be appropriate (see Section 12).

11. Landscape and Other Considerations

- One native or naturalized shade tree should be planted in the front and rear yards of in fill lots with 25 feet or more in depth to front of house.

Comments

1. The new house is proposed to be set 20' from the front property line. The average front setback of the blockface is 29.8'; however, the blockface is long and features a wide variety of front setbacks. The final site plan should include a walkway from the front of the house to the street.

2. Overall, the block lacks significant context. Nearby houses are shotgun-style and Minimal Traditionals, and there is infill construction and modified Craftsman bungalows/cottages on the neighboring block on Hiawassee Avenue. The proposed new house is proportionate to the dimensions of the lot and to other houses on the block.

3. Infill Housing design guidelines recommend that on lots without alleys, new driveways should be at least 20' behind the front façade of the infill house with access limited to one lane between the street and the front façade. Parking is currently proposed for the front yard and should be revised to meet guidelines. The final site plan should meet City Engineering standards.

4. The three-bay façade is similar in scale and height to the context.

5. The design includes a 6' deep, half-length front porch recessed under the primary roofline, supported by two square columns made from an unspecified material. Guidelines typically recommend a porch 8'-12' deep. The porch depth should be revised to meet guidelines.

6. Guidelines recommend window and door styles be similar to historic houses on the block, with similar placement and ratio of solid to void, and also note that "contemporary windows such as 'picture windows' should not be used." The design primarily uses paired single-light picture windows, which are incompatible with the context where 1/1 single-hung windows are most common. The front and rear elevations contain sufficient transparency. The right elevation contains one paired picture window, and the left elevation features a single-hung window and a small picture window. Picture windows should be revised to be single- or double-hung, and one window should be added to the right and left elevations, with details submitted to staff for approval.

7. The hipped roof has a sufficiently steep pitch for the neighborhood context, and the design benefits from the added complexity of the front-gable massing and front-gable dormer that project from the façade.

8. The materials for the roofing and siding were not provided, and the foundation appears to be a concrete slab. The slab foundation should be clad in stucco or parge-coated to match the context. Siding should be a horizontal lap siding with an overlap similar to wood clapboard patterns instead of Dutch lap or flush panel siding.

9. The site plan indicates a tree in the front yard, and the final site plan should also include a tree in the rear yard.

10. The three adjacent new houses are sufficiently differentiated from each other.

Recommendation

Staff recommends approval of Certificate 12-C-24-IH, subject to the following conditions: 1) final site plan to meet City Engineering standards; 2) modifications to the porch to meet Infill Housing guidelines; 3) use of lap siding with an overlap instead of Dutch lap or flush panel siding; 4) final site plan to include a walkway from the front door to the street; 5) revisions to parking to meet design guidelines and avoid the front yard; 6) revisions to façade and side elevation windows design and placement, with approval by staff; 7) final site plan to include one tree in the front and rear yards.





DESIGN REVIEW REQUEST

DOWNTOWN DESIGN (DK)

□ HISTORIC ZONING (H)

INFILL HOUSING (IH)

EDILMAR LOPEZ

Applicant			
11/19/2024	12/18/2024	12-C-24-IH	
Date Filed	Meeting Date (if applicable)	File Number(s)	

CORRESPONDENCE

All correspondence related to this application should be directed to the approved contact listed below.

Owner	Contractor	Engineer	Architect/Lar	ndscape Architect			
EDILMAR	LOPEZ						
Name				Company			
6045 BABI	ELAY RD			KNOXVILLE	TN	37924	
Address				City	State	Zip	
86528724	LVZCONSTRUCTION15@GMAILCOM						
Phone			Email				

CURRENT PROPERTY INFO

	6045 BABELAY RD KNOXVILLE TN 37924	8652872444	
Owner Name (if different from applicant)	Owner Address	Owner Phone	
200 HIAWASSEE AVE KNOXVILLE TN 37917	081BG001		
Property Address	Parcel ID		
LINCOLN PARK	RN-2		
Neighborhood	Zoning		

AUTHORIZATION

say Crockett Staff Signature

Please Print

Date

ir Lopez

EDILMAR LOPEZ

11/19/2024

Applicant Signature

Please Print


Date


REQUEST


DOWNTOWN DESIGN	Level 1: Signs Alteration of an existing building/structure Level 2: Addition to an existing building/structure Level 3: Construction of new building/structure Description of new building/structure Site design, parking, plazas, See required Downtown Design attachment for more details. Brief description of work:		
HISTORIC ZONING	Level 1: Signs Routine repair of siding, windows, roof, or other features, in-ki Level 2: Major repair, removal, or replacement of architectural elements or materia Level 3: Construction of a new primary building Level 4: Demolition of a contributing structure Relocation of a contributing structure Demolition of a contributing structure Brief description of work:	Ils Additions and accessory and access	structures
INFILL HOUSING	Level 1: Driveways, parking pads, access point, garages or similar facilities Level 2: Additions visible from the primary street Changes to porches visible from the primary street Image: New primary structure Image: Site built Image: Site built	rom the primary street	
STAFF USE ONLY	ATTACHMENTS Downtown Design Checklist Historic Zoning Design Checklist Infill Housing Design Checklist ADDITIONAL REQUIREMENTS Property Owners / Option Holders Level 1: \$50 • Level 2: \$100 • Level 3: \$250 • Level 4: \$500	FEE 1: FEE 2: FEE 3:	TOTAL: 2. 11/22/2024, SG




Hiawassee Avenue

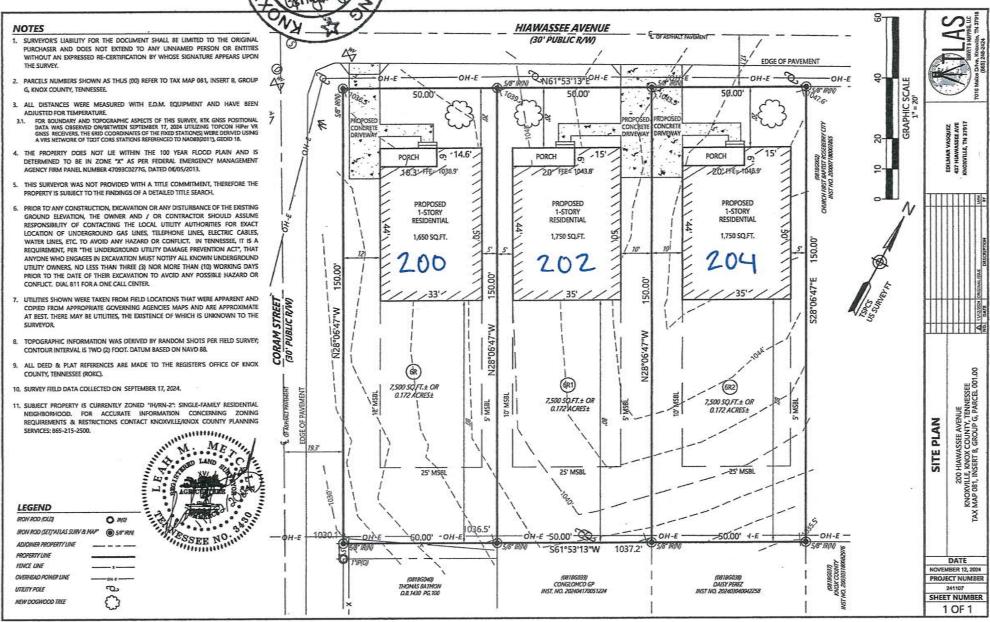

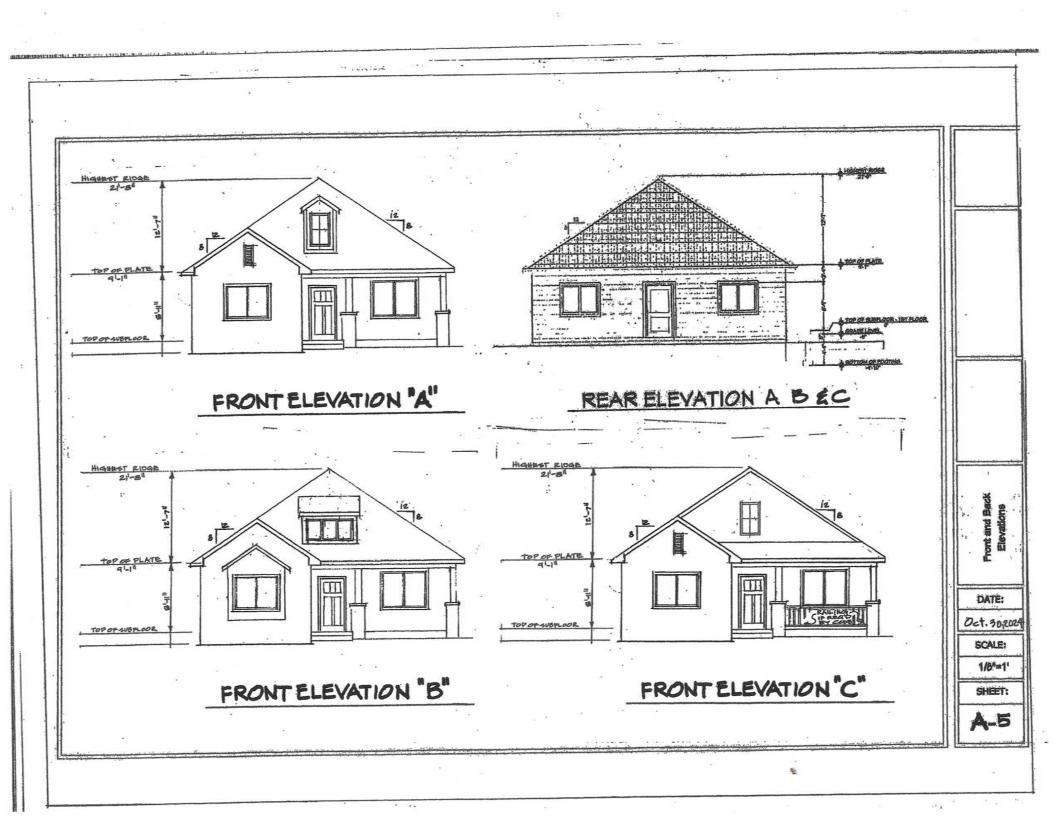

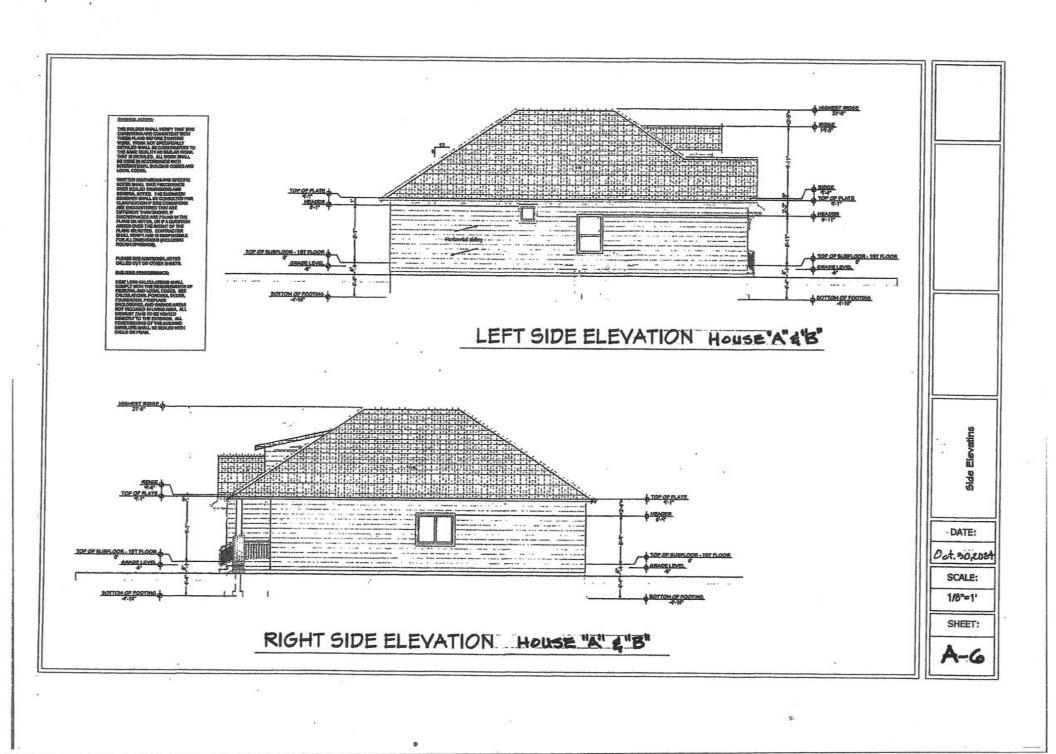


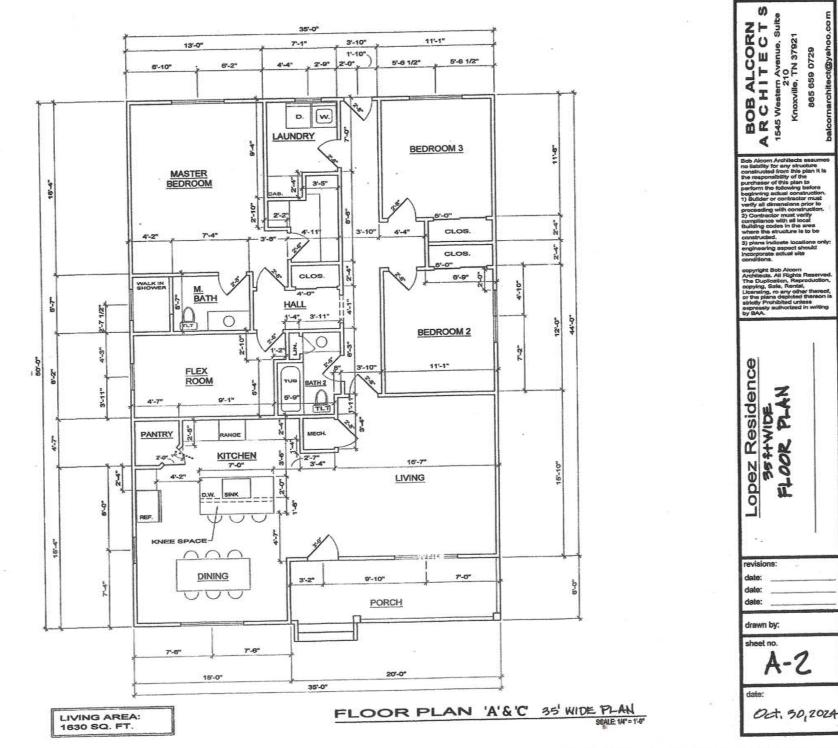

managements in state of the

Qyahoo

archite

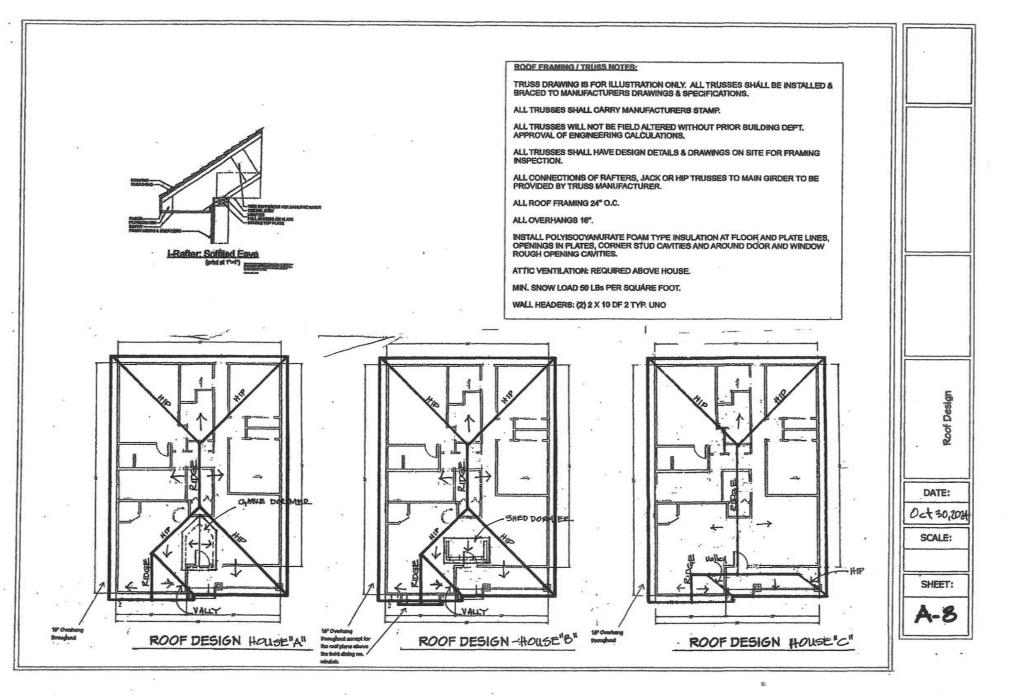

Internet and a state of the sta

- 192